

Manhole Inspection Summary

Manhole # S07KK_007MH

Printed On: 6/24/2010

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **07KK** Node: **007** Status: **Found**

Insp Date: **2/7/08 11:47 AM**

Incomplete Comments

Crew: **RL CB**
Inspector: **Lamont**
Firm: **URS**

Location Address: **3702 CLIFTON RD**

Cross Street: **ELSINORE AVE**

Manhole Type: **Junction**

Location: **Sidewalk**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover

Shape: **Circular**

Diameter: **26** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☐ Exists Material:

☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ **Debris**

Steps

Count: **7** Missing: **0** ☒ **Corroded**


Surcharge

☒ **Evidence Of Surcharge** Depth: **10** (ft.) ☐ Active Surcharge Present

Location View



Top View

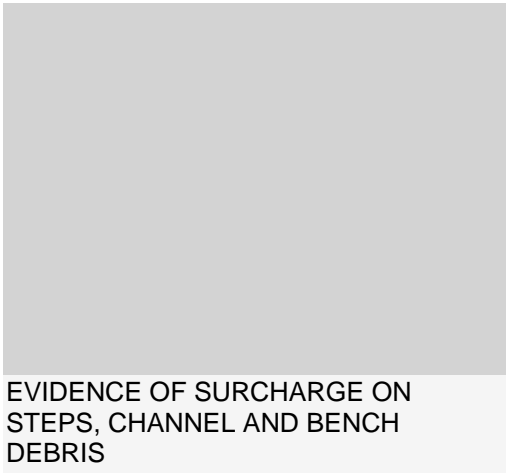

Manhole Inspection Summary

Manhole # S07KK_007MH

Printed On: 6/24/2010

Page 3 of 4

12 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



CHANNEL DEBRIS

Pipe Height: **12** (in.) Rod and Bar (Angled)
Pipe Material: **Unknown** ☐ Pipe Lined
Invert Depth: **13.50** (ft.) Flow Characteristics: **Slow**
Deposits: ☐ None ☐ Mud ☐ ~~Gravy~~ ☒ **Debris** ☐ Grease
Silt Depth: **12** (in.) Deposits Extent: **Heavy**
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

12 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: **12** (in.) Rod and Bar (Angled)
Pipe Material: **Clay** ☐ Pipe Lined
Invert Depth: **13.30** (ft.) Flow Characteristics: **Slow**
Deposits: ☒ None ☐ Mud ☐ ~~Gravy~~ ☐ Debris ☐ Grease
Silt Depth: (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S07KK_007MH

Printed On: 6/24/2010

Page 4 of 4

12 in. Circular Gravity Sewer
Pipe In @ 9 O'Clock

9 O'Clock Inflow



Pipe Height: 12 (in.) Rod and Bar (Angled)
Pipe Material: Clay ☐ Pipe Lined
Invert Depth: 13.40 (ft.) Flow Characteristics: Slow
Deposits: ☐ None ☐ Mud ☒ Sludge ☐ Debris ☒ Grease
Silt Depth: 2 (in.) Deposits Extent: Light
Infiltration: None Pipe Seal Cond: Sound

Drop: None

Connects To: Manhole
☐ Possible Illicit Connection